

# Concrete in Practice

What, why & how?



## CIP 23 - Discoloration


### WHAT is Discoloration?

Surface discoloration is the non-uniformity of color or hue on the surface of a single concrete placement. It may take the form of dark blotches or mottled discoloration on flatwork surface, gross color changes in large areas of concrete caused by a change in the concrete mix, or light patches of discoloration caused by efflorescence. In this context, it is not intended to include stains caused by foreign material that comes in contact with the concrete surface after placement and curing, such as storm water runoff, irrigation, corrosion products, oil leaking from automobiles, etc.

### WHY does Discoloration Occur?

Discoloration due to changes in cementitious materials or fine aggregate sources in subsequent batches in a placement sequence could occur, but is generally rare and insignificant. Concrete with a higher w/cm will generally be lighter in color. Inconsistent use of admixtures, insufficient mixing time, and improper timing of finishing operations can also cause discoloration. A yellowish to greenish hue may appear on concrete containing ground slag as a cementitious material. This will disappear with time, generally within a one year period. Concrete containing slag cement does, however, have a generally lighter color. The discoloration of concrete cast in forms or in slabs on grade is usually the result of a change in either the concrete composition or a concrete construction practice. In most studies, no single factor seemed to cause discoloration.

Factors found to influence discoloration are: the use of calcium chloride, variation in cement alkali content, delayed hydration of the cement paste, admixtures, hard-troweled surfaces, inadequate or inappropriate

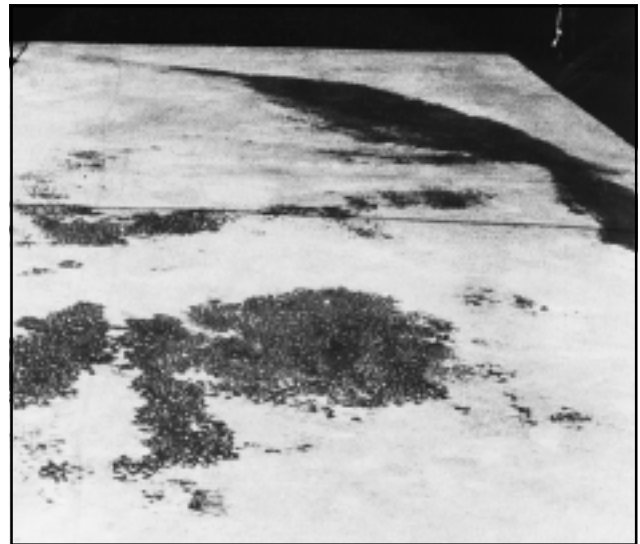

curing, concreting practices and finishing procedures that cause surface variation of the water-cementitious materials ratio, and changes in the concrete mixture proportions or constituents.

### HOW to Avoid Discoloration?

1. Calcium chloride in concrete can cause concrete discoloration. Flake or pelletized calcium chloride, when not mixed uniformly, discolors more than liquid calcium chloride.
2. The type, kind, and condition of formwork can influence surface color. Forms with different rates of absorption will cause surfaces with different shades of color. A change in the type or brand of a form release agent can also change concrete color.
3. Eliminate trowel burning (hard troweling of surface after it has become too stiff to trowel properly) of the concrete. Concrete which has been hard-troweled may have dark discoloration as a result of densifying the surface, which reduces the w/cm (water to cementitious materials ratio). The

resulting low w/cm affects the hydration of the cement ferrites which contributes to a darker color. Concrete surfaces that are troweled too early will increase the water-cement ratio at the surface and lighten the color.

- Concrete which is not properly or uniformly cured may develop discoloration. Uneven curing will affect the degree of hydration of the cement. Curing with polyethylene may also cause discoloration. When portions of the plastic sheeting are in direct contact with the concrete while other portions are not, it will cause variations in color. Using an even application of a quality spray or curing compound may be the better alternative.
- The discoloration of a slab may be minimized or prevented by moistening absorptive subgrades, following proper curing procedures, and adding proper protection of the concrete from drying by the wind and sun.

## HOW to Remove Discoloration?

Certain treatments have been found to be successful in removing or decreasing the surface discoloration of concrete flatwork. Discoloration caused by calcium chloride admixtures and some finishing and curing methods can be reduced by repeated washing with hot water and a scrub brush. The slab should be alternately flushed and brushed, and then dried overnight until the discoloration disappears.

If a discoloration persists, a dilute solution (1% concentration) of hydrochloric (muriatic) acid or dilute solutions (3% concentration) of weaker acids like acetic or phosphoric acid may be tried. Prior to using acids, dampen the surface to prevent it from penetrating into the concrete and flush with clean water within 15 minutes of application.

The use of a 20% to 30% water solution of diammonium citrate (2 lbs. in 1 gallon of water) has

been found to be a very effective treatment for most discoloration. Apply the solution to a dried surface for 15 minutes. A whitish gel that forms should be diluted with water and agitated by brushing. Subsequently, the gel should be completely washed off with water. More than one treatment may be required.

Some types of discoloration, such as trowel burning, may not respond to any treatment. It may be necessary to paint or use another type of coating to eliminate the discoloration. Some types of discoloration may, however, fade with wear and age.

## PRECAUTIONS?

Chemical methods to remove discoloration may significantly alter the color of concrete surfaces. Inappropriate or improper use of chemicals to remove discoloration may aggravate the situation. A trial treatment on an inconspicuous area is recommended. Acids should be thoroughly flushed from a concrete surface.

## References

- Greening, N. R. and Landgren, R., *Surfaces Discoloration of Flatwork*, Portland Cement Association RD 203, 1966.
- Steve Kosmatka, *Discoloration of Concrete, Causes and Remedies*, Concrete Products, April 1987.
- Neal, R. E., *Discoloration of Concrete Flatwork*, Lehigh Portland Cement Company, 1977.
- "Removing Stains and Cleaning Concrete Surfaces," IS214.02T, PCA, 1988, [www.cement.org](http://www.cement.org).
- "Discoloration: Myths, Causes and Cures," Rech, D. P., Owl Rock Products, 1989.
- C.F. Ferrington, R.L. Stowe, W.G. Miller, *Removing Stains from Mortar and Concrete*, Corps of Engineers, Vicksburg, Mississippi, Miscellaneous Paper C-68-8.
- Eugene, O. Goeb, *Discolored Concrete Surfaces*, Concrete Products, Vol. 96, No. 2, February, 1993.
- Concrete Slab Surface Defects: Causes, Prevention, Repair*, IS177.04T, PCA, 2001, [www.cement.org](http://www.cement.org).

## CAUTIONS

The user of chemicals should refer to a Material Safety Data Sheet (MSDS) or manufacturer guidelines to be aware of the toxicity, flammability, and/or health hazards associated with the use of the material. The appropriate safety procedures, such as the use of chemical resistant gloves, goggles, respirators, and chemical resistant clothing may be required in the MSDS.

1993, 2007



National Ready Mixed Concrete Association • 900 Spring Street, Silver Spring, MD 20910 • [www.nrmca.org](http://www.nrmca.org) • 888-84NRMCA

© National Ready Mixed Concrete Association (NRMCA). Technical information prepared by NRMCA. All rights reserved.

No part of this publication may be reproduced in any form, including photocopying or other electronic means, without permission in writing from NRMCA.